

BULLETIN NO : TB-0171
DATE : January 31, 2002
TO : All Fostex Distributors
FROM : Customer Service Department
SUBJECT : DV40 Software Update to V1.01

MODEL : DV40

The DV40 software has been updated to V1.01 to rectify the following point. The V1.01 software in the shape of WinZip compressed file "DV40V101.zip" is sent to you via email. By extracting the compressed file, two files "dv40e101.mot" for the Ether Card PCB and "dv40m101.mot" for the Main (CPU Module) PCB are newly created. Please burn these two software files into a CD-R disk and update the DV40 software accordingly. The version number and programming date displayed on the DV40 FL display in the SETUP menu are as follow.

Version Main
02Y01M22D 1-01

Version Ethernet
02Y01M22D 1-01

• **Noise Problem**

We found that the noise is randomly output in the INPUT MONITOR mode when setting the sampling frequency to either 44.1kHz or 48kHz on DV40 with V1.00 software. This is the software bug on the V1.00 software causing the A/D converter AK5394 to malfunction. The noise problem can be solved by updating the software to V1.01. Using the above latest software files, please kindly update the DV40 software at your end.

CAUTION: Every time the DV40 software is updated, initialize DV40 by the following procedures.

- 1) Put DV40 into Service Mode by pressing the [SETUP] key while holding down the [STOP] key.
- 2) Rotate the jog dial and select an optional menu "Memory Initial ?".
- 3) Press the [ENTER/YES] key to initialize DV40.

Thank you + best regards,